


Safety Notice

Cryogenic fluids can cause severe burns. Vessels under pressure should not be worked on until vessel pressure and product is removed. For protection against injury, be sure to wear face, hand and body safety equipment before working on or with cryogenic and gas products.

Be sure that tools, hands, parts and work area are free from any hydrocarbons. Specifically any dirt, oil or grease.

Parts must be cleaned for oxygen service if they will be exposed to product.

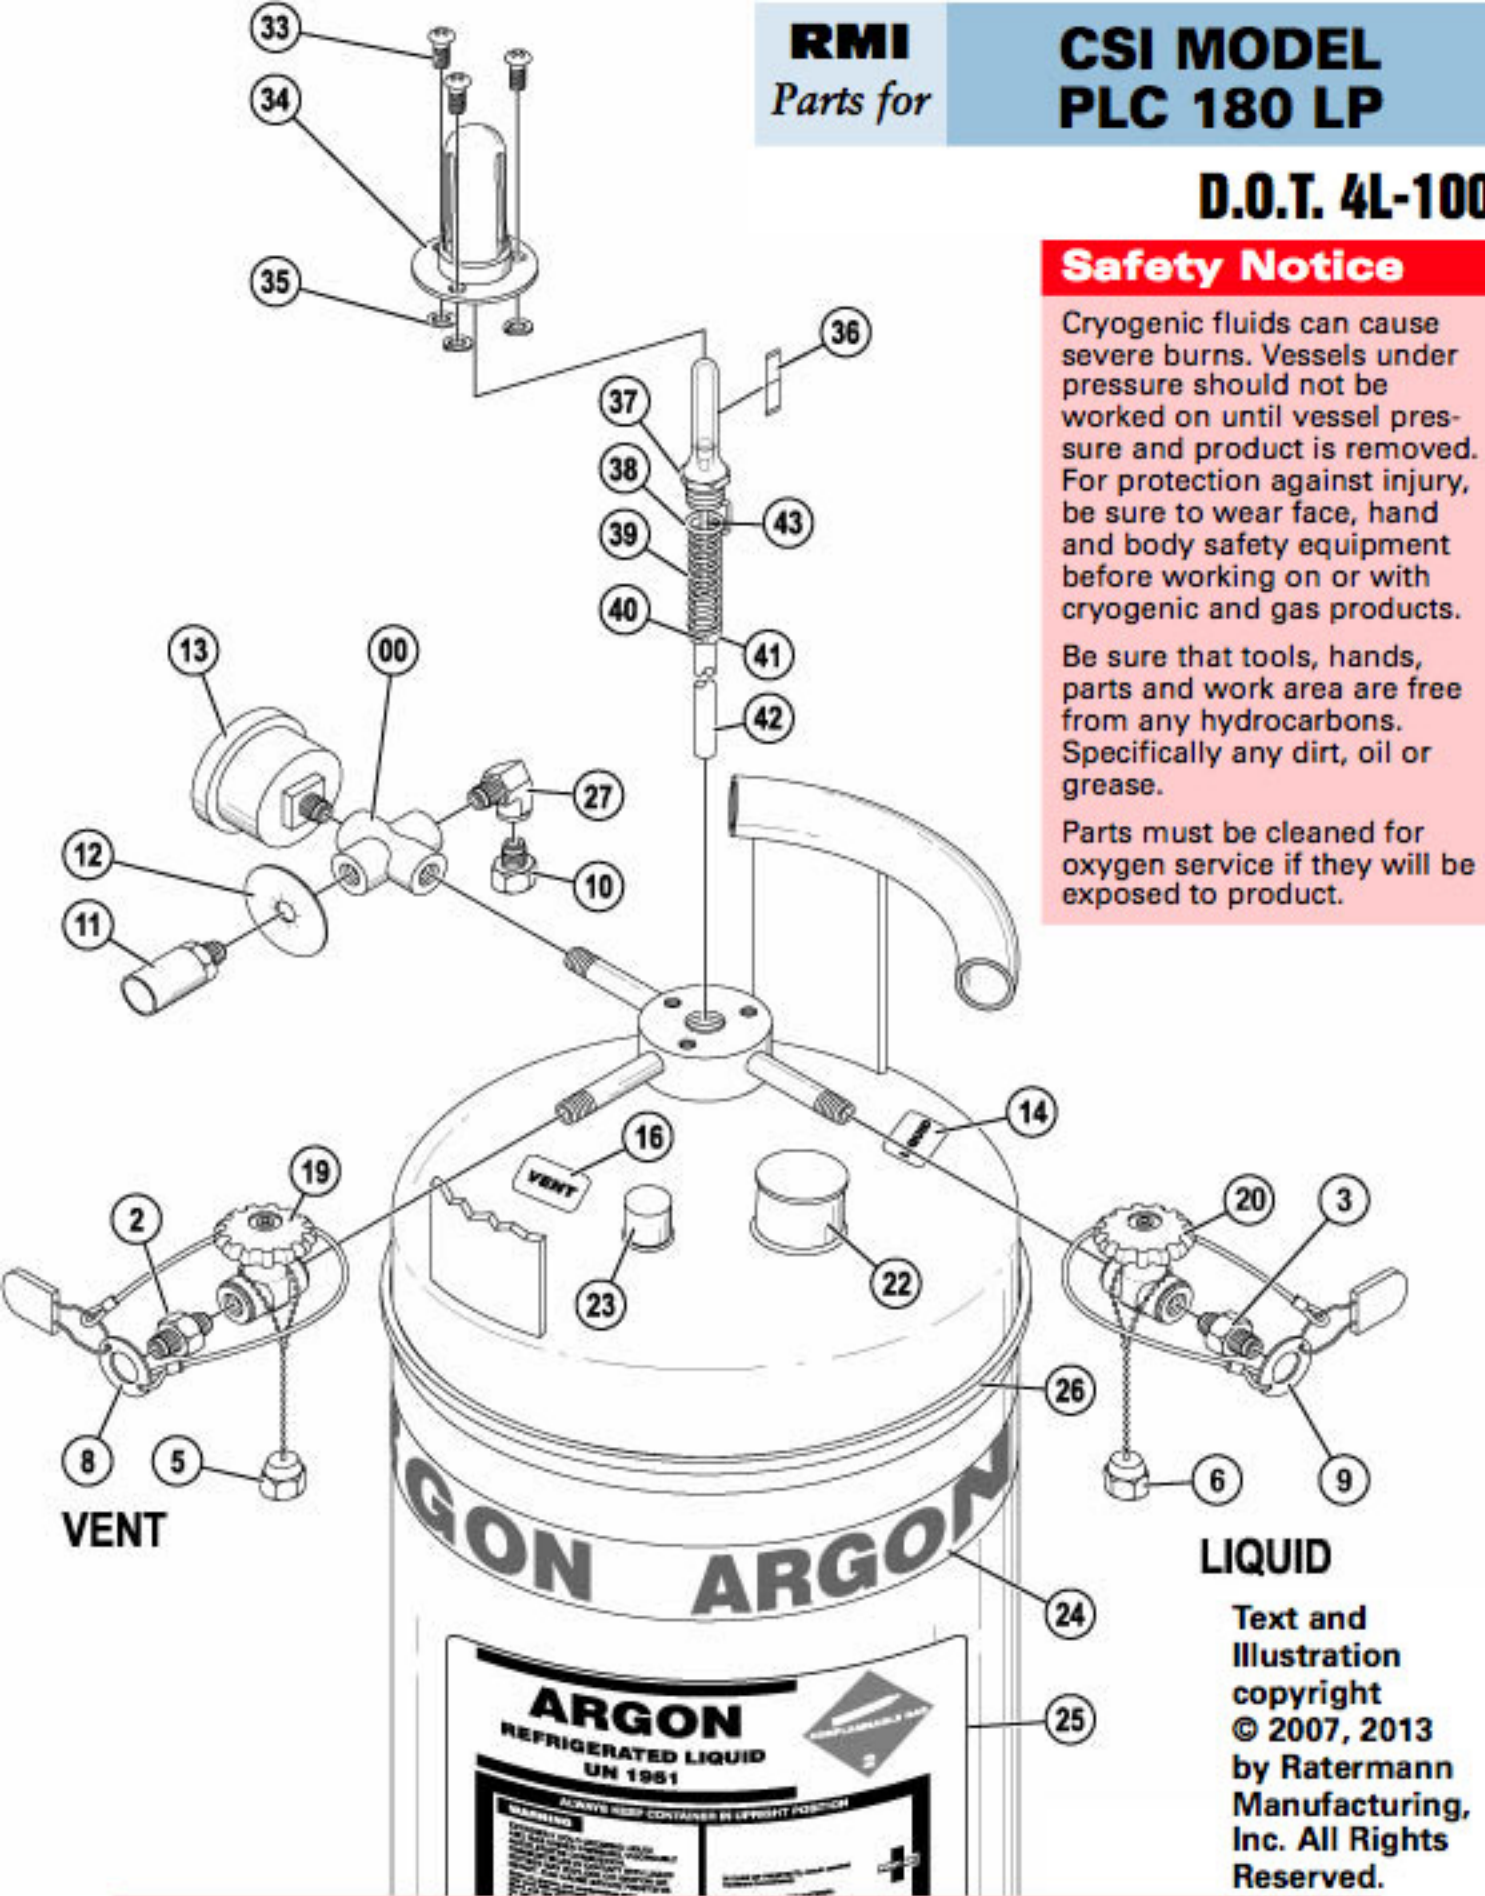

SAFETY WARNING

Nitrile Latex-Free Gloves should be worn at all times when working on Oxygen containers. Nitrile Latex-Free gloves will NOT give protection from cold or cryogenic liquids.

Text and
Illustration
copyright
© 2007, 2013
by Ratermann
Manufacturing,
Inc. All Rights
Reserved.